



S8FS-C

Models with DIN rail


S8FS-C015□□D (15 W)

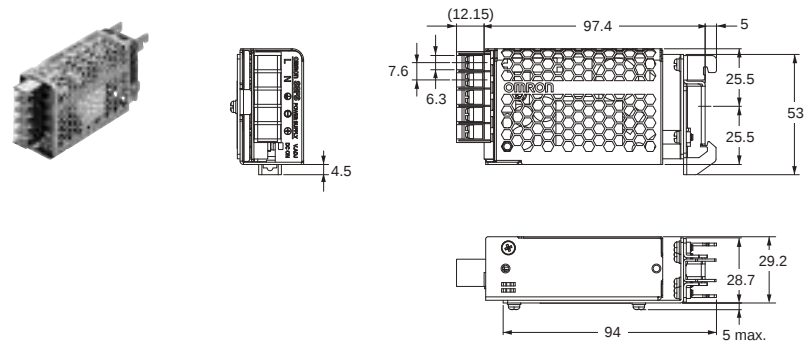


S8FS-C025□□D (25 W)

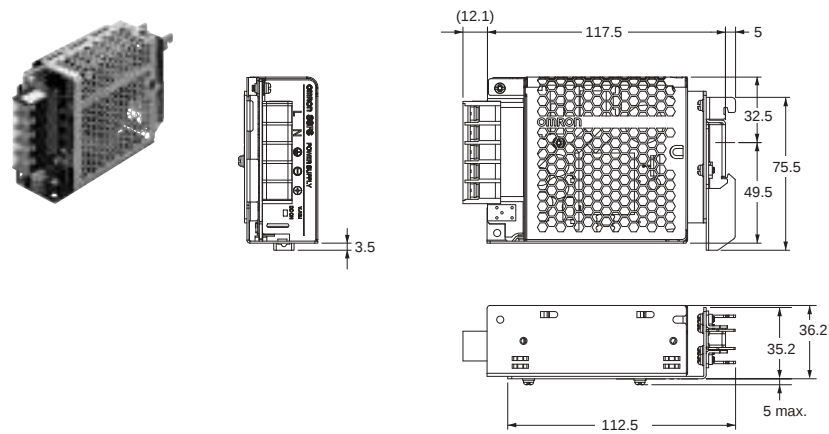


S8FS-C035□□D (35 W)

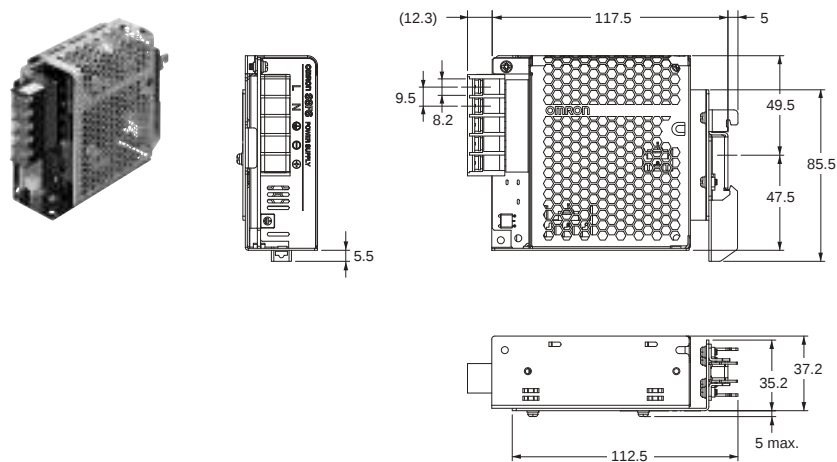

S8FS-C050□□D (50 W)

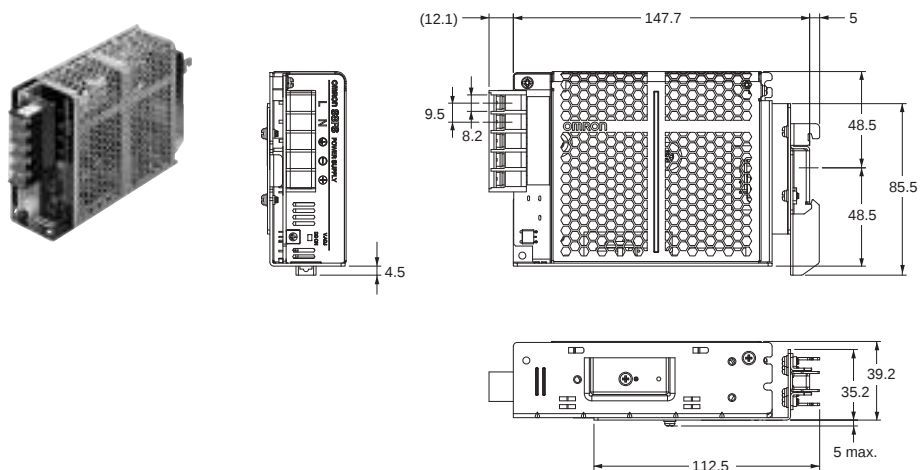


S8FS-C075□□D (75 W)
S8FS-C100□□D (100 W)

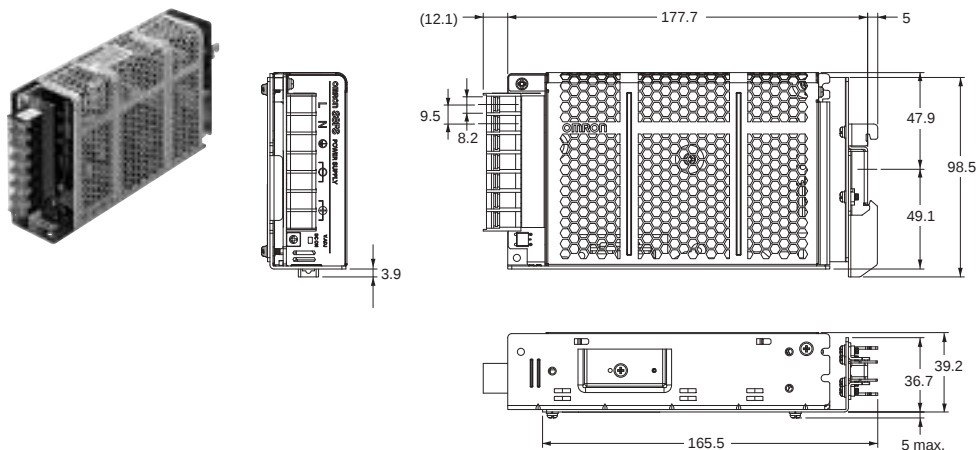


Note: The figure shows a 100-W Power Supply.
A 75-W Power Supply has 5 terminals.

S8FS-C150□□D (150 W)

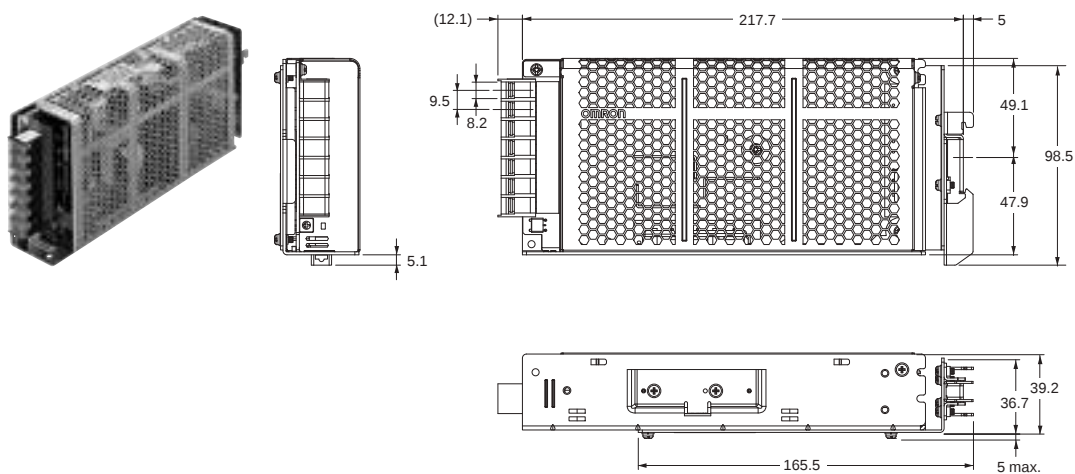


S8FS-C

S8FS-C200□□D (200 W)

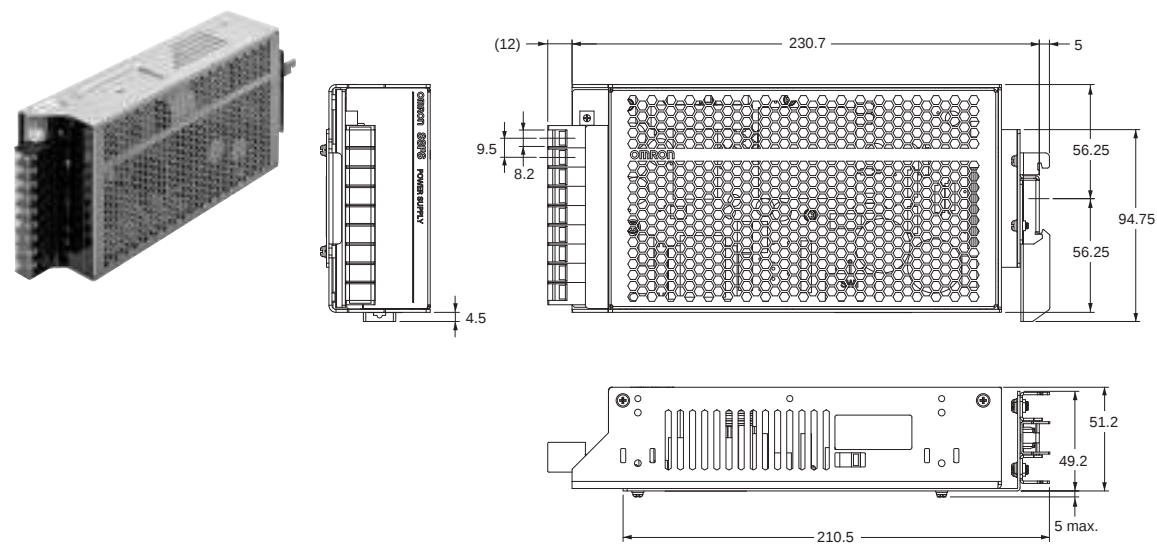



S8FS-C350□□D (350 W)

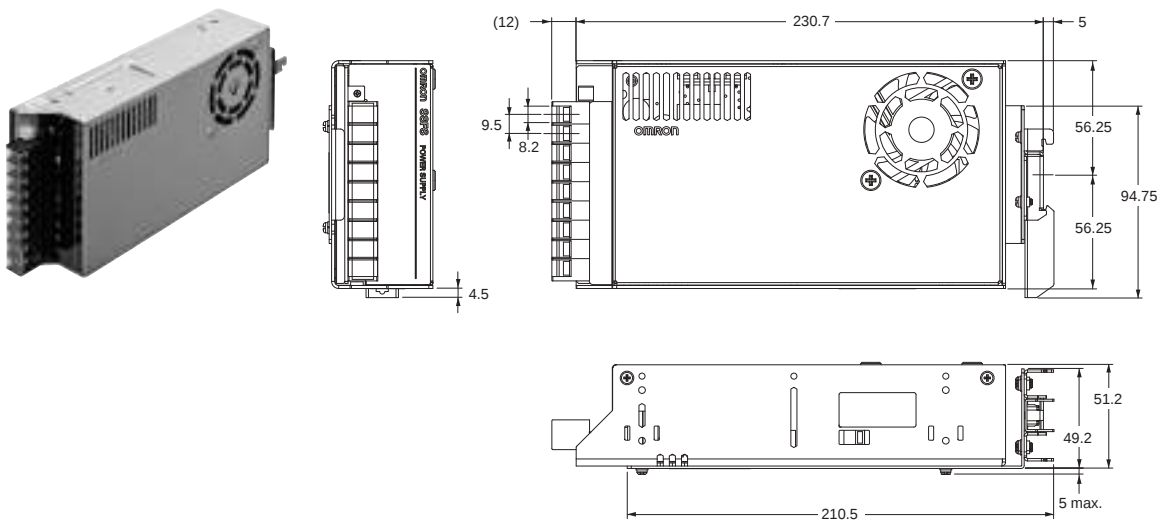


Mounting Brackets (Order Separately)

Power rating	Mounting direction	Model
15 W	DIN Rail	S82Y-FSC015DIN
25 W		S82Y-FSC025DIN
35 W		S82Y-FSC050DIN
50 W		
75 W		S82Y-FSC150DIN
100 W		
150 W		
200 W		S82Y-FSC350DIN
350 W		
15 W	Bottom-mounting to DIN Rail	S82Y-FSC015DIN-S
25 W		S82Y-FSC025DIN-S
35 W		S82Y-FSC035DIN-S
50 W		S82Y-FSC050DIN-S
75 W		S82Y-FSC100DIN-S
100 W		
150 W		S82Y-FSC150DIN-S
200 W		Bottom-mounting with L-brackets
350 W		


S82Y-FSC015DIN

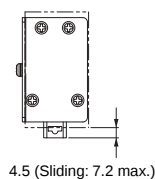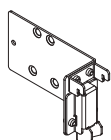

4.5 (Sliding: 7.2 max.)


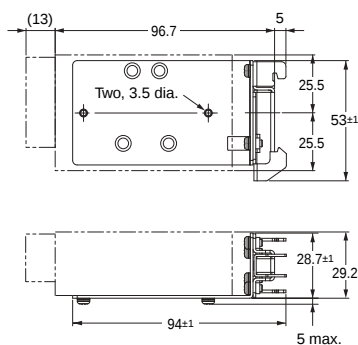


Mounting Method

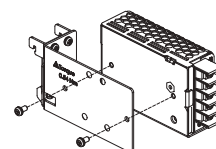


Accessories (2 locations)
Be sure to use the accessory screws.
Mounting screw tightening torque: 0.48 to 0.59 N·m for M3 screws


S82Y-FSC025DIN

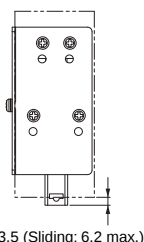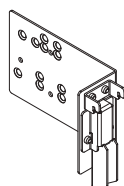



3.5 (Sliding: 6.2 max.)

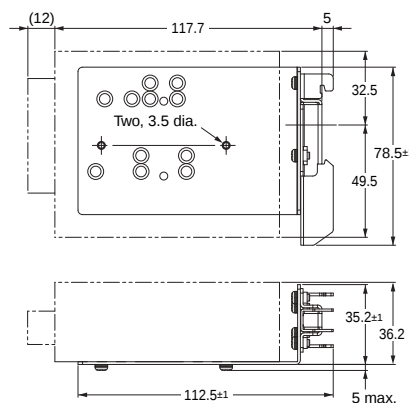


Mounting Method

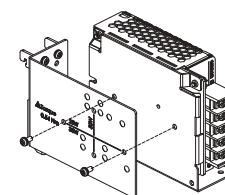

Accessories (2 locations)
Be sure to use the accessory screws.
Mounting screw tightening torque: 0.48 to 0.59 N·m for M3 screws

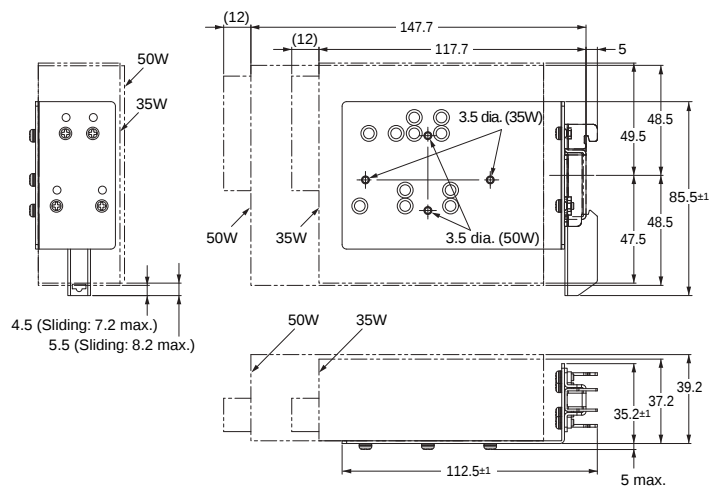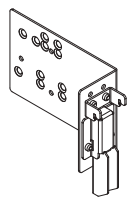


Accessories (2 locations)
Be sure to use the accessory screws.
Mounting screw tightening torque:
0.48 to 0.59 N·m for M3 screws

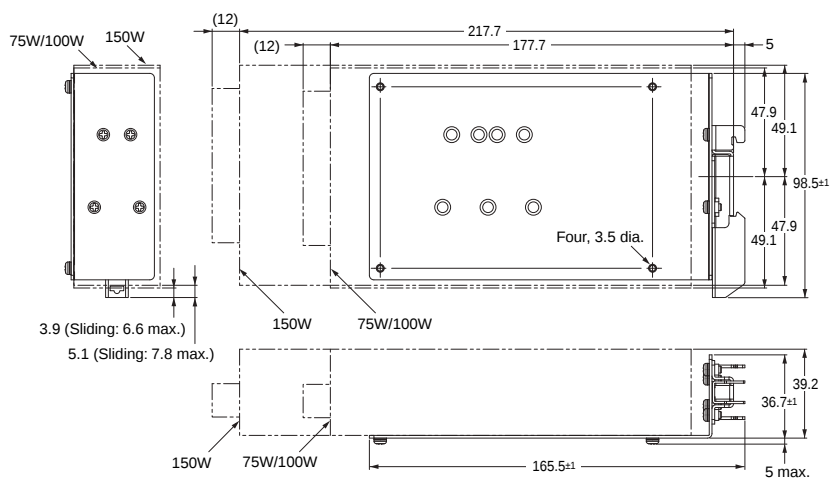

Accessories (4 locations)
Be sure to use the accessory screws.
Mounting screw tightening torque:
0.48 to 0.59 N·m for M3 screws

Technical drawing of a metal bracket assembly. It consists of a long rectangular plate with two circular holes on the left side and one circular hole on the right side. The plate is attached to a vertical base plate. The base plate has two vertical slots and two circular holes. Two vertical rods are shown passing through the base plate, secured with nuts and washers.

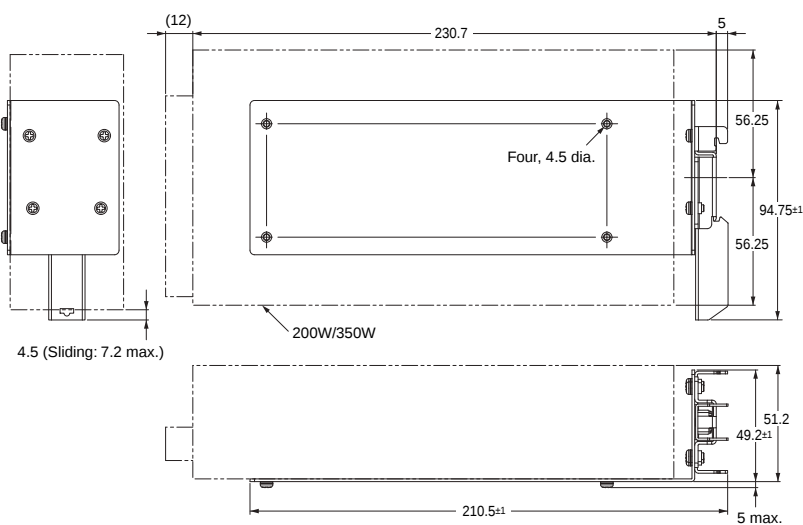

Accessories (4 locations)
Be sure to use the accessory screws.
Mounting screw tightening torque:
1.08 to 1.32 N·m for M4 screws